

## Technical Bulletin – July 13, 2015

### 360 Y-DROP™ Z Bracket Warranty Kits


We have become aware of a possible issue that could lead to the Z bracket on the sprayer systems to become damaged and bent where it connects to the 360 Y-DROP boom. The square u-bolts may also loosen. See the photo below.



To help alleviate the possible issue, we have developed and sent you 360 Y-DROP Z Bracket Warranty Kits with the items necessary to reinforce the Z bracket and eliminate the issue. There are Warranty Kit options for 40 ft. (Part No. 411102), 60 ft. (Part No. 411100) or 80 ft. (Part No. 411101) booms, depending on the original install size. The Warranty Kits include:

- New Z brackets (same as original mount package; for replacement if your Z bracket is damaged)
- New u-bolts (same as original mount package)
- 3/8 in. thick by 3 in. long steel plate to place between the Z bracket and the 360 Y-DROP boom
- Double washers to use with the u-bolts
- Nylock nuts to use to keep the u-bolts tight

**See photos and install instructions below.**

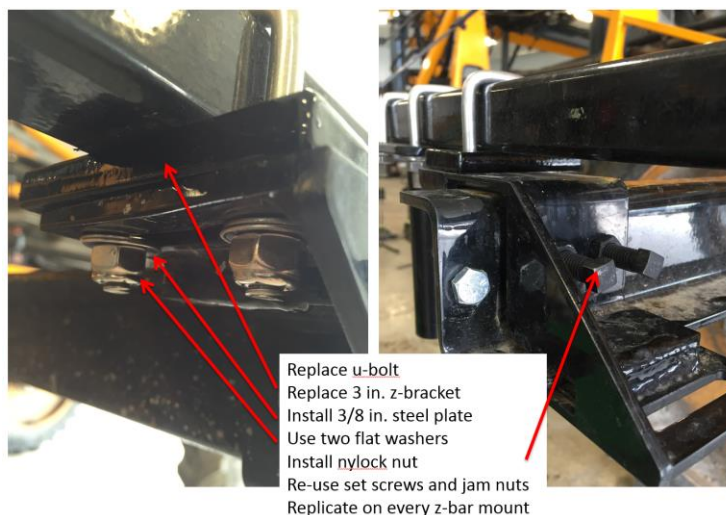

If you have questions or need additional 360 Y-DROP Z Bracket Warranty Kits, please reach out to your Regional Agronomy Manager or contact the Support Center at 888-512-4890.